

# Model ESFR-25 Early Suppression, Fast Response Pendent Sprinklers 25.2 K-factor

## General Description

The TYCO Model ESFR-25 Pendent Sprinklers are Early Suppression, Fast Response Sprinklers" having a nominal K-factor of 25.2. (Refer to Figure 1.) They are suppression-mode sprinklers that are especially advantageous as a means of eliminating the use of in-rack sprinklers when protecting high-piled storage.

The Model ESFR-25 Sprinklers are primarily used for ceiling-only sprinkler protection of (but not limited to) the following storage applications:

- Most encapsulated or non-encapsulated common materials including cartoned, unexpanded plastics.
- Uncartoned (exposed) expanded plastics in accordance with NFPA 13 and FM Global standards.
- Some storage arrangements of rubber tires, roll paper, flammable liquids, aerosols, and automotive components.

For more specific criteria, refer to Table 1 as well as the applicable design standard.

The Model ESFR-25 Pendent Sprinklers provide the system designer with hydraulic and sprinkler placement options not presently available to the traditional ESFR sprinklers having nominal K-factors of 14.0 and 16.8. In particular, the Model ESFR-25 Sprinkler has been designed to operate at substantially lowerend head pressures, as compared

#### **IMPORTANT**

Always refer to Technical Data Sheet TFP700 for the "INSTALLER WARNING" that provides cautions with respect to handling and installation of sprinkler systems and components. Improper handling and installation can permanently damage a sprinkler system or its components and cause the sprinkler to fail to operate in a fire situation or cause it to operate prematurely.

to ESFR Sprinklers having nominal K-factors of 14.0 and 16.8. This feature offers flexibility when sizing system piping, as well as possibly reducing or eliminating the need for a system fire pump.

Also, Model ESFR-25 Sprinklers permit use of a maximum deflector-to-ceiling distance of 18 inches (460 mm) versus 14 inches (356 mm). Additionally, a storage arrangement of 40 ft. (12,2 m) with a ceiling height of 45 ft. (13,7 m) does not require in-rack sprinklers as do other ESFR Sprinklers having nominal K-factors of 14.0 and 16.8.

The Model ESFR-25 Sprinklers are listed by Underwriters Laboratories (UL) for specific applications with a maximum storage height of 43 ft. (13,1 m) with a maximum ceiling height of 48 ft. (14,6 m) without the requirement for in-rack sprinklers. Refer to the Specific Application Listing (UL) for the design criteria.

Applications for the TYCO ESFR Sprinklers are expanding beyond currently recognized installation standards. For information on research fire tests (e.g., with flammable liquids and aerosols) that may be acceptable to an authority having jurisdiction, contact the Technical Services department.

#### NOTICE

The Model ESFR-25 Sprinklers described herein must be installed and maintained in compliance with this document, as well as with the applicable standards of the National Fire Protection Association, in addition to the standards of any authorities having jurisdiction (e.g., FM Global). Failure to do so may impair the performance of these devices.

The owner is responsible for maintaining their fire protection system and devices in proper operating condition. The installing contractor or sprinkler manufacturer should be contacted with any questions.

In all cases, the appropriate NFPA or FM installation standard, or other applicable standard, must be referenced to ensure applicability and to obtain complete installation guidelines. The general guidelines in this data sheet are not intended to provide complete installation criteria.



## Sprinkler Identification Number (SIN)

TY9226

TY9226 is a re-designation for C9226, G8441, and S8010.

## Technical Data


**Approvals** 

UL and C-UL Listed FM and VdS Approved LPCB Approved (094b/01 and 07l/01) NYC under MEA 356-01-E CE Certified Certificate of Conformity 1725-CPD-H0010

Maximum Working Pressure 175 psi (12,1 bar)

Pipe Thread Connections 1 inch NPT ISO 7-R1

**Discharge Coefficient** K = 25.2 GPM/psi<sup>1/2</sup> (362,9 LPM/bar<sup>1/2</sup>)

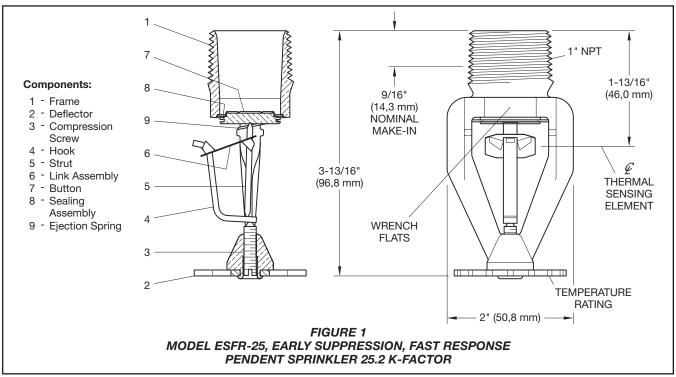

Temperature Ratings 165°F (74°C) 214°F (101°C)

#### Finish Natural Brass

**Physical Characteristics** 

Frame Brass
Deflector Bronze
Compression Screw Stainless Steel
HookMonel
Strut Monel
Link Assembly Solder, Nickel
Button Brass
Sealing Assembly Beryllium Nickel
with TEFLON
Ejection SpringInconel

## Design Criteria

The following general guidelines provided for the TYCO Model ESFR-25 Pendent Sprinklers can be used for a quick reference.

The National Fire Protection Association (NFPA) and FM Global (FM) provide installation standards that must be used to properly design an automatic sprinkler system utilizing Early Suppression, Fast Response (ESFR) Sprinklers. The guidelines provided by NFPA and FM may differ. Consequently, the appropriate standard must be used for a given installation.

In all cases, the appropriate NFPA or FM installation standard must be referenced to ensure applicability and

to obtain complete installation guidelines. The following general guidelines are not intended to provide complete installation criteria.

In addition to this data sheet, the following data sheets describe other TYCO ESFR Sprinklers:

- TFP315 Model ESFR-17 (TY7226), K=16.8 Pendent Sprinkler
- TFP316 Model ESFR-17 (TY7126), K=16.8 Upright Sprinkler
- TFP318 Model ESFR-1 (TY6226), K=14.0 Pendent Sprinkler

System Type Wet pipe system

#### **Roof Construction**

Unobstructed or obstructed construction; for example, smooth ceiling, bar joists, beam and girder, and so forth. Where the depths of the solid structural members (e.g., beams and stem) exceed 12 inches (302 mm), install ESFR Sprinklers in each channel formed by the structural members.

#### **Ceiling Slope**

Maximum 2 inch rise for 12 inch run (16.7%)


#### **Maximum Coverage Area**

100 ft<sup>2</sup> (9,3 m<sup>2</sup>). In some cases, the installation standards permit a greater coverage area.

Minimum Coverage Area 64 ft<sup>2</sup> (5,8 m<sup>2</sup>) per NFPA 13/FM 2-0

#### **Maximum Spacing**

12 feet (3,7 m) for building heights up to 30 feet (9,1 m)

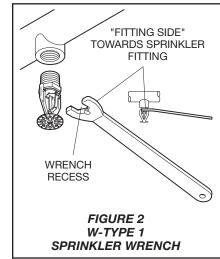

10 feet (3,1 m) for building heights greater than 30 feet (9,1 m). In some cases, installation standards permit a greater spacing.

#### Minimum Spacing 8 feet (2,4 m)

Minimum Clearance to Commodity 36 inches (914 mm)

## NFPA 13 Deflector-to-Ceiling Distance

6 to 18 inches (152 to 457 mm)

#### FM 2-0

Consult FM and/or FM Guidelines for allowable deflector-to-ceiling distances as well as thermal sensing element-to-ceiling criteria.

Storage Type	NFPA	FM
Open Frame (that is, no solid shelves) Single, Double, Multiple-Row, or Portable Rack Storage of Class I-IV and Group A or B Plastics	Refer to NFPA 13, Chapters 16 and 17.	Refer to FM 2-0 and 8-9.
Solid Pile or Palletized Storage of Class I-IV and Group A or B Plastics	Refer to NFPA 13, Chapters 14 and 15.	Refer to FM 2-0 and 8-9.
Idle Pallet Storage	Refer to NFPA 13, Chapter 12.	Refer to FM 2-0, 8-9, and 8-24.
Rubber Tire Storage	Refer to NFPA 13, Chapter 18.	Refer to FM 2-0 and 8-9.
Rolled Paper Storage (Refer to the standard.)	Refer to NFPA 13, Chapter 19.	Refer to FM 8-21.
Flammable Liquid Storage (Refer to the standard.)	Refer to NFPA 30.	N/A
Aerosol Storage (Refer to the standard.)	Refer to NFPA 30B.	Refer to FM 7-31.
Automotive Components in Portable Racks (Control mode only; refer to the standard.)	Refer to NFPA 13, Chapter 20.	N/A

N/A = Non-Applicable

## TABLE 1 COMMODITY SELECTION AND DESIGN CRITERIA OVERVIEW FOR MODEL ESFR-25 PENDENT SPRINKLERS

## Specific Application Listing (UL)

The TYCO Model ESFR-25 Pendent Sprinklers are listed by Underwriters Laboratories for Specific Applications with a ceiling height greater than 45 ft. (13,7 m) up to and including 48 ft. (14,6 m), and a storage arrangement up to and including 43 ft. (13,1 m), the following guideline are provided for the TYCO Model ESFR-25 Pendent Sprinklers:

#### **Sprinkler Position**

Pendent, frame arms aligned with pipe, deflectors parallel with ceiling or roof.

### System Type

### Wet Pipe System only.

Maximum Area of Coverage 100 ft<sup>2</sup> (9,3 m<sup>2</sup>). In some cases, the installation standards permit a greater coverage area.

#### Minimum Area of Coverage 64 ft2 (5,8 m2) according to NFPA 13.

#### Maximum Slope Ceiling 2 inch rise for 12 inch run (16.7%)

#### **Maximum Spacing**

10 ft. (3,1 m). In some cases, the installation standards permit a greater spacing.

## Minimum Spacing 8 ft. (2,4 m)

## **Temperature Rating** 214°F (101°C)

# **Deflector Distance from Walls**Minimum of 4 inches (102 mm) from walls but no more than 1/2 the allowable distance permitted between sprinklers.

#### **Deflector to Top of Storage** Minimum of 36 inches (914 mm).

Deflector to Ceiling Distance 6 to 14 inches (152 to 356 mm).

## Maximum Ceiling Height 48 ft. (14,6 m)

Maximum Storage Height 43 ft. (13,1 m)

#### Storage Arrangement

Palletized, solid piled, open frame; single row, double row, or multiple row and portable rack arrangement.

#### Commodity

Class I-IV

Cartoned, unexpanded plastic

#### **Sprinkler System Design**

NFPA 13 for ESFR Sprinklers based upon 45 psi (3,1 bar) design pressure 169 gpm (640 L/m) with 12 sprinkler remote area.

## Minimum Aisle Width 8 ft (2,4 m)

## **Operation**

The fusible link assembly is comprised of two link halves that are joined together by a thin layer of solder. When the rated temperature is reached, the solder melts and the two link halves separate, activating the sprinkler and flowing water.

## Installation

The TYCO Model ESFR-25 Pendent Sprinklers must be installed in accordance with this section.

#### **General Instructions**

Damage to the fusible Link Assembly during installation can be avoided by handling the sprinkler by the frame arms only (that is, do not apply pressure to the fusible Link Assembly), and by using the appropriate sprinkler wrench. Failure to do so can lead to an unstable link assembly and premature activation of the sprinkler. Damaged sprinklers must be replaced.

A leak-tight 1 inch NPT sprinkler joint should be obtained by applying a minimum-to-maximum torque of 20 to 30 ft./lbs. (26,8 to 40,2 Nm). Higher levels of torque can distort the sprinkler inlet with consequent leakage or impairment of the sprinkler.

**Step 1.** Install the Model ESFR-25 Pendent Sprinkler in the pendent position (Figure 2).

**Step 2.** With pipe-thread sealant applied, hand-tighten the sprinkler into the sprinkler fitting. Do not apply pressure to the Link Assembly, and handle the Model ESFR-25 Pendent Sprinkler only by the Frame arms.

**Step 3.** Wrench-tighten the Model ESFR-25 Pendent Sprinkler using only the W-Type 1 Sprinkler Wrench (Figure 2) and by fully engaging (seating) the wrench on the sprinkler wrench flats (Figure 1).

**Step 4.** After installation, inspect the Link Assembly of each Model ESFR-25 Pendent Sprinkler for damage. In particular, verify that the Link Assembly and Hook are positioned as illustrated in Figure 1, and that the Link Assembly is not bent, creased, or forced out of normal position in any way. Replace damaged sprinklers.

# Care and Maintenance

The TYCO Model ESFR-25 Pendent Sprinklers must be maintained and serviced in accordance with this section.

Before closing a fire protection system main control valve for maintenance work on the fire protection system that it controls, permission to shut down the affected fire protection system must be obtained from the proper authorities and notify all personnel who may be affected by this action.

Sprinklers which are found to be leaking or exhibiting visible signs of corrosion must be replaced.

Automatic sprinklers must never be painted, plated, coated, or otherwise altered after leaving the factory. Modified sprinklers must be replaced. Sprinklers that have been exposed to corrosive products of combustion, but have not operated, should be replaced if they cannot be completely cleaned by wiping the sprinkler with a cloth or by brushing it with a soft bristle brush.

Care must be exercised to avoid damage to the sprinklers - before, during, and after installation. Sprinklers damaged by dropping, striking, wrench twist/slippage, or the like, must be replaced. Also, replace any sprinkler that has a cracked bulb or that has lost liquid from its bulb. (Ref. Installation Section.)

The owner is responsible for the inspection, testing, and maintenance of their fire protection system and devices in compliance with this document, as well as with the applicable standards of the National Fire Protection Association (e.g., NFPA 25), in addition to the standards of any authorities having jurisdiction. Contact the installing contractor or sprinkler manufacturer regarding any questions.

Automatic sprinkler systems are recommended to be inspected, tested, and maintained by a qualified Inspection Service in accordance with local requirements and/or national codes.

## Ordering Procedure

Contact your local distributor for availability. When placing an order, indicate the full product name and Part Number (P/N).

#### Sprinkler Assemblies

Specify: Model ESFR-25 (TY9226), K=25.2, Early Suppression, Fast Response Pendent Sprinkler with (specify) temperature rating, natural brass, P/N (specify).

## Special-Order Sprinkler Assemblies with ISO 7/1 Thread Connections

Specify: Model ESFR-25 (TY9226), K=25.2, Early Suppression, Fast Response Pendent Sprinkler with ISO 7/1 thread connection, (specify) temperature rating, natural brass, P/N (specify).

#### Sprinkler Wrench

Specify: W-Type 1 Sprinkler Wrench, P/N 56-872-1-025.